Item No.	Description	Condition	Remedial Work/Cost	Time Frame	Photos
1.	Village Centre 1935 building, incorporating: Ground Floor - shop, changing rooms, Post Office (not accessed); First Floor - Office (Cameron's Recruitment) 'Museum room' store not accessed.	Roof: Natural Cotswold Slate laid in diminishing sized courses. General weathering/spalling with a number of nibbed slates, minor slippage and moss/weeds, etc., particularly in the valley areas.	Short term: roofer to replace any slipped slates, remove moss, debris from valley areas, and general check elsewhere. Long term: you should allow for stripping the whole roof covering. Consider replacement with good imitation Cotswold slate, e.g., www.cardinalslates.co.uk - generally accepted in Conservation areas and even on some listed houses, as a close match and at a significant saving in cost. Reclaimed original slates can then be sold to offset the cost. Costs will depend on discussions with Conservation Officer and vary enormously from say, £15,000 to £35,000 depending on discussions and what can be salvaged and re-	Time Frame Within 12 months Within 5 years	Photos 002-005; 010
			, ,		

Item No.	Description	Condition	Remedial Work/ Cost	Time Frame	Photos
1. – continued	Village Centre 1935 building, continued	Rainwater goods: metal components supported by metal brackets. General corrosion and peeling paintwork to most gutters and downpipes.	Allow for taking down all rainwater goods, wire brushing down, resealing and redecoration. Allow for replacement of any components found to be beyond repair Estimated cost: allow £2,000	Within 12 months	018 - 020
		Walls: dressed Cotswold stone with dressing to window/door surrounds and elsewhere.	None required in short/medium term.		
		Windows: original metal framed windows with leaded panes – some corrosion evident and a few cracked panes.	Allow for 'conservation repair' replacing any cracked panes and redecorate. Estimated cost: Allow £3,000	12 – 24 months	021 – 024
2.	Electrics	Mixed age wiring.	Allow for test and report and quote for cost of any necessary upgrading: allow £300 for initial report, and PC sum of £1,000 for upgrading works	Arrange test in 2019	064
			Office installation tested in 2014, with recommendations for reinspection 2019.		065
3.	Attic area (accessed from 1 st floor office)	Some 'daylight' visible where torching has loosened.	See earlier comments regarding reroofing.	Within 12 months	053
		Vent to gable wall allowing bird entry.	Builder to fit mesh to the vent. Allow £50		046

Item No.	Description	Condition	Remedial Work/ Cost	Time Frame	Photos
3.	Attic area continued	Active woodworm noticed to rafters.	Treatment by a specialist – allow £750.	Within 12 months	049
		Old redundant galvanised water tanks.	Consider removal, (not strictly necessary), when roof re-covered.		050
4.	Decorations	1 st floor Office in good condition. Elsewhere, in need of redecoration, especially changing areas.	Cyclical redecoration needed on a rolling programme. Allow £4,000	Within 12-24 months	
5.	Cellar	Wooden access hatch showing signs of decay. Old water tank and pipework	Replace wooden hatch (possibly with a steel one). Allow £1,000 Improve ventilation. Consider removal (although little gain as cellar floods in any event).	Within 12-24 months	122 119, 120
6.	Outbuilding	Same materials as Centre	 Overhaul of guttering; Replaced damaged slates (in longer term recover); Remove vegetation in valley and check/review condition. Estimated cost of above: £1,500 In time, this roof will need to be replaced. Discuss with Cottsway 	Within 12 months	031 – 033; 026; 028
			Housing Association with a view to doing whole roof, and review timetable		

Item No.	Description	Condition	Remedial Work/ Cost	Time Frame	Photos
		Repoint approximately 2 m ² of stonework, where open joints exist, in matching mortar.	Allow £250.	12-24 months	077
7.	Playground area and wooden seated shelter	Deterioration of roof slates.	Strip/re-cover – as with discussion with Conservation Officer.	Within 36 months	085 – 088
8.	Boundary walls	Generally in fair condition but some repair needed in various locations around playground and bowling green.	Experienced stone waller should be employed on day rate. Allow for 10 days @ £200 per day	Within 24 months	091, 099
9.	Playground	PC should commission independent report from Playground Inspector to ensure that the whole area (equipment, surfaces etc) complies with EN 1176 (playground equipment) And EN 1177 (safety surfacing)	Inspection report (Initial report – allow £150) Damaged surfaces need repair	Immediately	081, 082 095
10.	Swimming pool	Similar report recommended to ensure compliance and satisfaction of insurers.	Inspection report (initial report – allow £150)	Immediately	094

Item No.	Description	Condition	Remedial Work/ Cost	Time Frame	Photos
11.	War Memorial	Generally satisfactory. Uneven stone paving.	Re-grout, but limited improvement possible to address unevenness without taking up whole area and renewing.	Not urgent	104
			Questionable if this is really warranted.	Not urgent	
			Redecorate 2 metal benches	Within 24 months	103
12.	Bus shelter	Generally satisfactory	Check roof and renew small number of slipped slates	Within 5 years	107-110
13	Bowls Club Pavillion	Dated, but structurally generally sound	Bitumen roof likely to need replacing within next 5 years Allow £2,500		
			Timber cladding: redecorated and renew any defective joinery.		137
			Electrics: Arrange test and report		
			Internal refit? (new kitchen etc) Allow £5-10,000 depending on		
			extent of works		